

Report on

# GEN-2016-087 Modification Request Impact Study

Revision R1 June 2, 2025

Submitted to Southwest Power Pool



## **TABLE OF CONTENTS**

Revisi	on HistoryR-1				
Execu	tive Summary	ES-1			
1.0	Scope of Study	1			
1.1	Reactive Power Analysis	1			
1.2	Short Circuit Analysis & Stability Analysis	1			
1.3	Steady-State Analysis	1			
1.4	Study Limitations	1			
2.0	Project and Modification Request	2			
3.0	Existing vs Modification Comparison	4			
3.1	Stability Model Parameters Comparison	4			
3.2	Equivalent Impedance Comparison Calculation	4			
4.0	Reactive Power Analysis	5			
4.1	Methodology and Criteria	5			
4.2	Results	5			
5.0	Short Circuit Analysis	7			
5.1	Methodology	7			
5.2	Results	7			
6.0	Dynamic Stability Analysis	8			
6.1	Methodology and Criteria	8			
6.2	Fault Definitions	9			
6.3	Results	14			
7.0	Material Modification Determination	17			
7.1	Results	17			



### **LIST OF TABLES**

Table ES-1: GEN-2016-087 Modification Request	ES-1
Table 2-1: GEN-2016-087 Modification Request	3
Table 4-1: Shunt Reactor Size for Reactive Power Analysis	5
Table 5-1: Short Circuit Model Parameters*	7
Table 5-2: POI Short Circuit Comparison Results	7
Table 5-3: 25SP Short Circuit Comparison Results	
Table 6-1: Fault Definitions	
Table 6-2: GEN-2016-087 Dynamic Stability Results	14
LIST OF FIGURES	
Figure 2-1: GEN-2016-087 Single Line Diagram (Existing Configuration*)	2
Figure 2-2: GEN-2016-087 Single Line Diagram (Modification Configuration)	
Figure 4-1: Existing GEN-2016-087 Single Line Diagram (Shunt Sizes)	
Figure 4-2: Modification GEN-2016-087 Single Line Diagram (Shunt Sizes)	

## **APPENDICES**

APPENDIX A: GEN-2016-087 Generator Dynamic Model

APPENDIX B: Short Circuit Results

APPENDIX C: Dynamic Stability Results with Existing Base Case Issues & Simulation Plots



## **Revision History**

DATE OR VERSION NUMBER	AUTHOR	CHANGE DESCRIPTION
6/2/2025	Aneden Consulting	Initial Report Issued

## **Executive Summary**

Aneden Consulting (Aneden) was retained by the Southwest Power Pool (SPP) to perform a Modification Request Impact Study (Study) for GEN-2016-087, an active Generation Interconnection Request (GIR) with a Point of Interconnection (POI) at the Campbell County 230 kV Substation.

The GEN-2016-087 project interconnects in the Western Area Power Administration (WAPA) transmission system with a capacity of 98.9 MW. This Study has been requested to evaluate the modification of GEN-2016-087 to change the configuration to 29 x GE wind turbines operating at 3.4 MW for a total assumed dispatch of 98.6 MW. The project is also changing the configuration to share a generation interconnection line with the existing Cambell County Windfarm 1 project.

In addition, the modification request included changes to the collection system, generator step-up transformers, and main substation transformers. The existing and modified configurations for GEN-2016-087 are shown in Table ES-1 below.

Table ES-1: GEN-2016-087 Modification Request

Facility	Existing Modeled Configuration <sup>1</sup>	Modification Configuration
racility	Existing Modeled Configuration	Modification Configuration
Point of Interconnection	CAMPBELL 230.0 kV (652499)	CAMPBELL 230.0 kV (652499)
Configuration/Capacity	43 x GE 2.3 MW (wind) = 98.9 MW	29 x GE 3.4 MW (wind) = 98.6 MW [dispatch]
		Shared with Campbell County Windfarm 1:
	Length = 0.5 miles	Length = 0.09 miles
Generation Interconnection Line	R = 0.000000 pu	R = 0.000025 pu
Generation interconnection Line	X = 0.000100 pu	X = 0.00013 pu
	B = 0.000000 pu	B = 0.0003 pu
	Rating MVA = 0.0 MVA	Rating A/B MVA = 319/351 MVA
Main Substation Transformer <sup>2</sup>	X = 7.996%, R = 0.267%, Winding MVA = 66 MVA, Rating MVA = 110 MVA	X12 = 9.746% R12 = 0.279%, X23 = 3.759% R23 = 0.107%, X13 = 13.095% R13 = 0.3741%, Winding MVA = 112 MVA, Winding 1, 2, & 3 Rating A/B/C MVA = 187/187/187 MVA
	Gen 1 Equivalent Qty: 43	Gen 1 Equivalent Qty: 29
Equivalent GSU Transformer <sup>2</sup>	X = 5.722%, R = 0.572%, Winding MVA = 111.8 MVA, Rating MVA = 111.8 MVA	X = 7.500%, R = 0.870%, Winding MVA = 110.519 MVA, Rating MVA = 110.519 MVA
	R = 0.008540 pu	R = 0.016200 pu
Equivalent Collector Line <sup>3</sup>	X = 0.013510 pu	X = 0.020600 pu
	B = 0.035580 pu	B = 0.053000 pu
Generator Dynamic Model <sup>4</sup> & Power Factor	43 x GE 2.3 MW (GEWTGCU1) <sup>4</sup> Leading: 0.99 Lagging: 0.99	29 x GE 3.4 MW (REGCA1) <sup>4</sup> Leading: 0.95 Lagging: 0.95

<sup>1)</sup> Based on the DISIS-2021-001 P2 Stability Model, 2) X and R based on Winding MVA, 3) All pu are on 100 MVA Base 4) DYR stability model name

SPP determined that steady-state analysis was not required because the modifications to the project were not significant enough to change the previously studied steady-state conclusions. However, SPP determined



that while the modification used the same turbine manufacturer, GE, the change in stability model from GEWTGCU1 to REGCA1 required short circuit and dynamic stability analyses.

The scope of this study included reactive power analysis, short circuit analysis, and dynamic stability analysis.

Aneden performed the analyses using the modification request data and the DISIS-2021-001 stability study models:

- 2025 Summer Peak (25SP),
- 2025 Winter Peak (25WP)

All analyses were performed using the Siemens PTI PSS/E<sup>1</sup> version 34 software and the results are summarized below.

The results of the reactive power analysis using the 25SP model showed that the GEN-2016-087 project needed a 5.3 MVAr shunt reactor on the 34.5 kV bus of the project substation with the modifications in place, an increase from the 3.6 MVAr found for the existing configuration. This is necessary to offset the capacitive effect on the transmission network caused by the project's transmission line and collector system during reduced generation conditions. The information gathered from the reactive power analysis is provided as information to the Interconnection Customer and Transmission Owner (TO) and/or Transmission Operator (TOP). The applicable reactive power requirements will be further reviewed by the TO and/or TOP.

The short circuit analysis was performed using the 25SP stability model modified for short circuit analysis. The results from the short circuit analysis with the updated topology showed that the maximum GEN-2016-087 contribution to three-phase fault currents in the immediate transmission systems at or near the GEN-2016-087 POI was 0.68 kA. The maximum three-phase fault current level within 5 buses of the POI was 24.7 kA for the 25SP model.

The dynamic stability analysis was performed using Siemens PTI PSS/E version 34.8.1 software for the two modified study models: 25SP and 25WP. 55 fault events were simulated, which included three-phase faults and single-line-to-ground stuck breaker faults.

The results of the dynamic stability analysis showed several existing base case issues that were found in both the original DISIS-2021-001 models and in the models with the GEN-2016-087 modification included. These issues were not attributed to the GEN-2016-087 modification request and are detailed in Appendix C.

There were no damping or voltage recovery violations attributed to the GEN-2016-087 modification request observed during the simulated faults. Additionally, the project was found to stay connected during the contingencies that were studied and, therefore, will meet the Low Voltage Ride Through (LVRT) requirements of FERC Order #661A.

Based on the results of the study, SPP determined that the requested modification is **not a Material Modification**. The requested modification does not have a material adverse impact on the cost or timing of any other Interconnection Request with a later Queue priority date.

<sup>&</sup>lt;sup>1</sup> Power System Simulator for Engineering





In accordance with FERC Order No. 827, the generating facility will be required to provide dynamic reactive power within the range of 0.95 leading to 0.95 lagging at the high-side of the generator substation.

It is likely that the customer may be required to reduce its generation output to 0 MW in real-time, also known as curtailment, under certain system conditions to allow system operators to maintain the reliability of the transmission network.

Nothing in this study should be construed as a guarantee of transmission service or delivery rights. If the customer wishes to obtain deliverability to final customers, a separate request for transmission service must be requested on Southwest Power Pool's OASIS by the customer.



## 1.0 Scope of Study

Aneden Consulting (Aneden) was retained by the Southwest Power Pool (SPP) to perform a Modification Request Impact Study (Study) for GEN-2016-087. A Modification Request Impact Study is a generation interconnection study performed to evaluate the impacts of modifying the DISIS study assumptions. The determination of the required scope of the study is dependent upon the specific modification requested and how it may impact the results of the DISIS study. Impacting the DISIS results could potentially affect the cost or timing of any Interconnection Request with a later Queue priority date, deeming the requested modification a Material Modification. The criteria sections below include reasoning as to why an analysis was either included or excluded from the scope of study.

All analyses were performed using the Siemens PTI PSS/E version 34 software. The results of each analysis are presented in the following sections.

#### 1.1 Reactive Power Analysis

SPP requires that a reactive power analysis be performed on the requested configuration if it is a non-synchronous resource. The reactive power analysis determines the capacitive effect at the POI caused by the project's collection system and transmission line's capacitance. A shunt reactor size was determined to offset the capacitive effect and maintain zero (0) MVAr injection at the POI while the plant's generators and capacitors were offline.

#### 1.2 Short Circuit Analysis & Stability Analysis

To determine whether stability and short circuit analyses are required, SPP evaluates the difference between the stability models, the stability model parameters and, if needed, the equivalent collector system impedance between the existing configuration and the requested modification. Dynamic stability analysis and short circuit analysis would be required if the differences listed above were determined to have a significant impact on the most recently performed DISIS stability analysis.

#### 1.3 Steady-State Analysis

Steady-state analysis is performed if SPP deems it necessary based on the nature of the requested change. SPP determined that steady-state analysis was not required because the modifications to the project were not significant enough to change the previously studied steady-state conclusions.

#### 1.4 Study Limitations

The assessments and conclusions provided in this report are based on assumptions and information provided to Aneden by others. While the assumptions and information provided may be appropriate for the purposes of this report, Aneden does not guarantee that those conditions assumed will occur. In addition, Aneden did not independently verify the accuracy or completeness of the information provided. As such, the conclusions and results presented in this report may vary depending on the extent to which actual future conditions differ from the assumptions made or information used herein.



## 2.0 Project and Modification Request

The GEN-2016-087 Interconnection Customer requested a modification to its Generation Interconnection Request (GIR) with a Point of Interconnection (POI) at the Campbell County 230 kV Substation in the Western Area Power Administration (WAPA) transmission system.

At the time of report posting, GEN-2016-087 is an active Interconnection Request with a queue status of "IA FULLY EXECUTED/ON SCHEDULE." GEN-2016-087 is a wind facility with a maximum summer and winter queue capacity of 98.9 MW with Energy Resource Interconnection Service (ERIS).

The GEN-2016-087 project is currently in the DISIS-2016-002 cluster. Figure 2-1 shows the power flow model single line diagram for the existing GEN-2016-087 configuration using the DISIS-2021-001 25SP stability model.



Figure 2-1: GEN-2016-087 Single Line Diagram (Existing Configuration\*)

\*based on the DISIS-2021-001 25SP stability models

This Study has been requested to evaluate the modification of GEN-2016-087 to change the configuration to 29 x GE wind turbines operating at 3.4 MW for a total assumed dispatch of 98.6 MW. The project is also changing the configuration to share a generation interconnection line with the existing Cambell County Windfarm 1 project.

In addition, the modification request included changes to the collection system, generator step-up transformers, and main substation transformers. Figure 2-2 shows the power flow model single line diagram for the GEN-2016-087 modification. The existing and modified configurations for GEN-2016-087 are shown in Table 2-1 below.



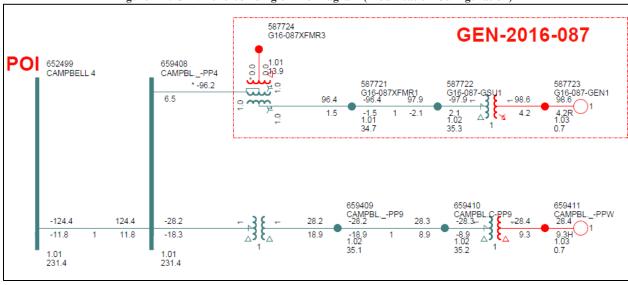


Figure 2-2: GEN-2016-087 Single Line Diagram (Modification Configuration)

Table 2-1: GEN-2016-087 Modification Request

	Table 2-1: GEN-2010-08/ Wodification Request				
Facility	Existing Modeled Configuration <sup>1</sup>	Modification Configuration			
Point of Interconnection	CAMPBELL 230.0 kV (652499)	CAMPBELL 230.0 kV (652499)			
Configuration/Capacity	43 x GE 2.3 MW (wind) = 98.9 MW	29 x GE 3.4 MW (wind) = 98.6 MW [dispatch]			
		Shared with Campbell County Windfarm 1:			
	Length = 0.5 miles	Length = 0.09 miles			
Generation Interconnection Line	R = 0.000000 pu	R = 0.000025 pu			
Generation interconnection Line	X = 0.000100 pu	X = 0.00013 pu			
	B = 0.000000 pu	B = 0.0003 pu			
	Rating MVA = 0.0 MVA	Rating A/B MVA = 319/351 MVA			
Main Substation Transformer <sup>2</sup>	X = 7.996%, R = 0.267%, Winding MVA = 66 MVA, Rating MVA = 110 MVA	X12 = 9.746% R12 = 0.279%, X23 = 3.759% R23 = 0.107%, X13 = 13.095% R13 = 0.3741%, Winding MVA = 112 MVA, Winding 1, 2, & 3 Rating A/B/C MVA = 187/187/187 MVA			
	Gen 1 Equivalent Qty: 43	Gen 1 Equivalent Qty: 29			
Equivalent GSU Transformer <sup>2</sup>	X = 5.722%, R = 0.572%, Winding MVA = 111.8 MVA, Rating MVA = 111.8 MVA	X = 7.500%, R = 0.870%, Winding MVA = 110.519 MVA, Rating MVA = 110.519 MVA			
	R = 0.008540 pu	R = 0.016200 pu			
Equivalent Collector Line <sup>3</sup>	X = 0.013510 pu	X = 0.020600 pu			
	B = 0.035580 pu	B = 0.053000 pu			
Generator Dynamic Model <sup>4</sup> & Power Factor	43 x GE 2.3 MW (GEWTGCU1) <sup>4</sup> Leading: 0.99 Lagging: 0.99	29 x GE 3.4 MW (REGCA1) <sup>4</sup> Leading: 0.95 Lagging: 0.95 inding MVA 3) All pu are on 100 MVA Base 4) DVR			

<sup>1)</sup> Based on the DISIS-2021-001 P2 Stability Model, 2) X and R based on Winding MVA, 3) All pu are on 100 MVA Base 4) DYR stability model name



## 3.0 Existing vs Modification Comparison

To determine which analyses are required for the Study, the differences between the existing configuration and the requested modification were evaluated. Aneden performed this comparison and the resulting analyses using a set of modified study models developed based on the modification request data and the DISIS-2021-001 stability study models. The analysis was completed using PSS/E version 34 software.

The methodology and results of the comparisons are described below.

#### 3.1 Stability Model Parameters Comparison

SPP determined that while the modification used the same turbine manufacturer, GE, the change in stability model from GEWTGCU1 to REGCA1 required short circuit and dynamic stability analyses. This is because the short circuit contribution and stability responses of the existing configuration and the requested modification's configuration may differ. The generator dynamic model for the modification can be found in Appendix A.

As short circuit and dynamic stability analyses were required, a stability model parameters comparison was not needed for the determination of the scope of the study.

#### 3.2 Equivalent Impedance Comparison Calculation

As the turbine stability model change determined that short circuit and dynamic stability analyses were required, an equivalent impedance comparison was not needed for the determination of the scope of the study.



## 4.0 Reactive Power Analysis

The reactive power analysis was performed for GEN-2016-087 to determine the capacitive charging effects during reduced generation conditions (unsuitable wind speeds, unsuitable solar irradiance, insufficient state of charge, idle conditions, curtailment, etc.) at the generation site and to size shunt reactors that would reduce the project reactive power contribution to the POI to approximately zero.

#### 4.1 Methodology and Criteria

For this analysis the Campbell County Windfarm 1 project that shares the gen-tie line was disconnected. The GEN-2016-087 generators were switched out of service while other system elements remained inservice. A shunt reactor was tested at the project's collection substation 34.5 kV bus to reduce the MVAr injection at the POI to zero. The size of the shunt reactor is equivalent to the charging current value at unity voltage and the compensation provided is proportional to the voltage effects on the charging current (i.e., for voltages above unity, reactive compensation is greater than the size of the reactor).

Aneden performed the reactive power analysis using the modification request data based on the 25SP DISIS-2021-001 stability study model.

#### 4.2 Results

The results from the analysis showed that the GEN-2016-087 project needed approximately 5.3 MVAr of compensation at its collector substation to reduce the MVAr injection at the POI to zero. This is an increase from the 3.6 MVAr found for the existing configuration. The final shunt reactor requirements are shown in Table 4-1. Figure 4-1 illustrates the shunt reactor size needed to reduce the POI MVAr to approximately zero with the existing configuration. Figure 4-2 illustrates the shunt reactor size needed to reduce the POI MVAr to approximately zero with the updated topology.

The information gathered from the reactive power analysis is provided as information to the Interconnection Customer and Transmission Owner (TO) and/or Transmission Operator (TOP). The applicable reactive power requirements will be further reviewed by the TO and/or TOP.

**Table 4-1: Shunt Reactor Size for Reactive Power Analysis** 

Machine	POI Bus Number POI Bus Name		Reactor Size (MVAr)
maonine	1 Of Bas Namber	i oi bus italiic	25SP
GEN-2016-087	652499	Campbell County 230 KV	5.3





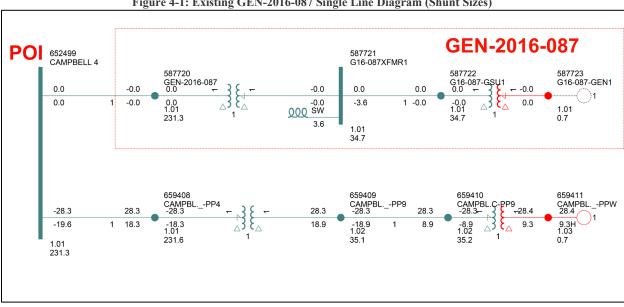


Figure 4-1: Existing GEN-2016-087 Single Line Diagram (Shunt Sizes)



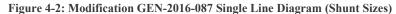

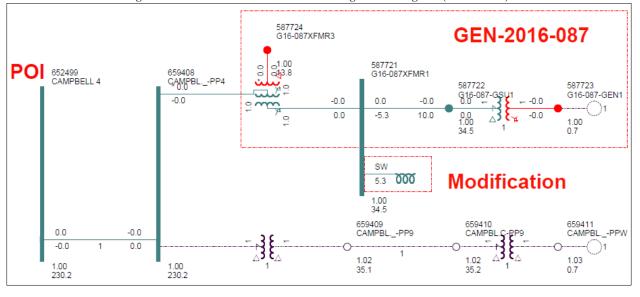

## **5.0 Short Circuit Analysis**

Aneden performed a short circuit study using the 25SP model for GEN-2016-087 to determine the maximum fault current requiring interruption by protective equipment for each bus in the relevant subsystem. The detailed results of the short circuit analysis are provided in Appendix B.

#### 5.1 Methodology

The short circuit analysis included applying a 3-phase fault on buses up to 5 levels away from the 230 kV POI bus. The PSS/E "Automatic Sequence Fault Calculation (ASCC)" fault analysis module was used to calculate the fault current levels in the transmission system with and without GEN-2016-087 online.

Aneden created a short circuit model using the 25SP DISIS-2021-001 stability study model by adjusting the GEN-2016-087 short circuit parameters consistent with the submitted data. The adjusted parameters used in the short circuit analysis are shown in Table 5-1 below. No other changes were made to the model.

Table 5-1: Short Circuit Model Parameters\*

Parameter	Value by Generator Bus#
	587723
Machine MVA Base	103.762
R (pu)	0.0
X" (pu)	0.2

<sup>\*</sup>pu values based on Machine MVA Base

#### 5.2 Results

The results of the short circuit analysis for the 25SP model are summarized in Table 5-2 and Table 5-3. The GEN-2016-087 POI bus (Campbell County 230 kV) fault current magnitudes for the comparison cases are provided in Table 5-2 showing a fault current of 4.22 kA with the GEN-2016-087 project online. Table 5-3 shows the maximum fault current magnitudes and fault current increases with the GEN-2016-087 project online.

The maximum fault current calculated within 5 buses of the POI was 24.7 kA for the 25SP model. The maximum GEN-2016-087 contribution to three-phase fault currents was about 19.2% and 0.68 kA.

Table 5-2: POI Short Circuit Comparison Results

	Case	GEN-OFF Current (kA)	GEN-ON Current (kA)	kA Change	%Change
ſ	25SP	3.54	4.22	0.68	19.2%

**Table 5-3: 25SP Short Circuit Comparison Results** 

Voltage (kV)	Max. Current (GEN-ON) (kA)	Max kA Change	Max %Change
69	3.1	0.02	1.2%
115	19.1	0.22	6.2%
230	24.7	0.68	19.2%
345	19.4	0.01	0.1%
Max	24.7	0.68	19.2%

7



## 6.0 Dynamic Stability Analysis

Aneden performed a dynamic stability analysis to identify the impact of the modifications to GEN-2016-087. The analysis was performed according to SPP's Disturbance Performance Requirements<sup>2</sup>. The modification details are described in Section 2.0 above and the dynamic modeling data is provided in Appendix A. The existing base case issues and simulation plots can be found in Appendix C.

#### 6.1 Methodology and Criteria

The dynamic stability analysis was performed using models developed with the requested GEN-2016-087 configuration of 29 x GE inverters operating at 3.4 MW (REGCA1). This stability analysis was performed using Siemens PTI's PSS/E version 34.8.1 software.

The modifications requested for the GEN-2016-087 project were used to create modified stability models for this impact study based on the DISIS-2021-001 stability study models:

- 2025 Summer Peak (25SP),
- 2025 Winter Peak (25WP)

The dynamic model data for the GEN-2016-087 project is provided in Appendix A. The power flow models and associated dynamic database were initialized (no-fault test) to confirm that there were no errors in the initial conditions of the system and the dynamic data.

The following system adjustments were made to address existing base case issues that are not attributed to the modification request:

- The frequency protective relay at bus 587723 was disabled after observing the generators tripping during initial three phase fault simulations. This frequency tripping issue is a known PSS/E limitation when calculating bus frequency as it relates to non-conventional type devices.
- The PSSE dynamic simulation iterations and acceleration factor were adjusted as needed to resolve PSSE dynamic simulation crashes.

During the fault simulations, the active power (PELEC), reactive power (QELEC), and terminal voltage (ETERM) were monitored for GEN-2016-087 and other current and prior queued projects in Group 1. In addition, voltages of five (5) buses away from the POI of the GEN-2016-087 were monitored and plotted. The machine rotor angle for synchronous machines and speed for asynchronous machines within the study areas including 330 (AECI), 526 (SPS), 600 (XEL), 615 (GRE), 620 (OTP), 627 (ALTW), 635 (MEC), 640 (NPPD), 645 (OPPD), 652 (WAPA), 659 (BEPC-SPP), 661 (MDU), 663 (BEPC-MISO), 672 (SPC), and 680 (DPC) were monitored. The voltages of all 100 kV and above buses within the study area were monitored as well.

 $https://www.spp.org/documents/28\bar{8}59/spp\%20 disturbance\%20 performance\%20 requirements\%20 (twg\%20 approved).pdf$ 



-

<sup>&</sup>lt;sup>2</sup> SPP Disturbance Performance Requirements:

#### **6.2 Fault Definitions**

Aneden developed fault events as required to study the modification. The new set of faults was simulated using the modified study models. The fault events included three-phase faults and single-line-to-ground stuck breaker faults. Single-line-to-ground faults are approximated by applying a fault impedance to bring the faulted bus positive sequence voltage to 0.6 pu. The simulated faults are listed and described in Table 6-1 below. These contingencies were applied to the modified 25SP and 25WP models.

**Table 6-1: Fault Definitions** 

	Table 6-1: Fault Definitions			
Fault ID	Planning Event	Fault Descriptions		
FLT1000-SB	P4	Stuck Breaker on CAMPBELL 4 (652499) 230 kV Bus a. Apply single phase fault at the CAMPBELL 4 (652499) 230 kV Bus b. Clear fault after 16 cycles and trip the following elements: b.1.Trip bus CAMPBELL 4 (652499) 230 kV. Trip generator(s) on the Bus CAMPBLPPW (659411) 0.7 kV Trip generator(s) on the Bus G16-087-GEN1 (587723) 0.7 kV		
FLT1001-SB	P4	Stuck Breaker on CAMPBELL 4 (652499) 230 kV Bus a. Apply single phase fault at the CAMPBELL 4 (652499) 230 kV Bus b. Clear fault after 16 cycles and trip the following elements: b.1.Trip the CAMPBELL 4 (652499) 230 kV to GLENHAM4 (661038) 230 kV line CKT 1.		
FLT1003-SB	P4	Stuck Breaker on GLENHAM4 (661038) 230 kV Bus a. Apply single phase fault at the GLENHAM4 (661038) 230 kV Bus b. Clear fault after 16 cycles and trip the following elements: b.1.Trip bus GLENHAM4 (661038) 230 kV. Trip generator(s) on the Bus NBCS_07PPR (659276) 12.5 kV		
FLT1004-SB	P4	Stuck Breaker on GLENHAM7 (661035) 115 kV Bus a. Apply single phase fault at the GLENHAM7 (661035) 115 kV Bus b. Clear fault after 16 cycles and trip the following elements: b.1.Trip bus GLENHAM7 (661035) 115 kV. Trip generator(s) on the Bus NBCS_07PPR (659276) 12.5 kV		
FLT1005-SB	P4	Stuck Breaker on BISMARK4 (652426) 230 kV Bus a. Apply single phase fault at the BISMARK4 (652426) 230 kV Bus b. Clear fault after 16 cycles and trip the following elements: b.1.Trip the BISMARK4 (652426) 230 kV / BISMARK7 (652427) 115 kV / BISMARK9 (652392) 12.5 kV XFMR CKT 1. b.2.Trip the BISMARK4 (652426) 230 kV to JAMESTN4 (652444) 230 kV line CKT 1. b.3.Trip the BISMARK4 (652426) 230 kV to WASHBRN4 (652456) 230 kV line CKT 1. b.4.Trip the BISMARK4 (652426) 230 kV to WARD 4 (652296) 230 kV line CKT 1. Trip generator(s) on the Bus G21-024-GEN1 (765522) 0.7 kV		
FLT1006-SB	P4	Stuck Breaker on BISMARK4 (652426) 230 kV Bus  a. Apply single phase fault at the BISMARK4 (652426) 230 kV Bus  b. Clear fault after 16 cycles and trip the following elements:  b.1.Trip the BISMARK4 (652426) 230 kV / BISMARK7 (652427) 115 kV / BISMARK29 (652467) 12.5 kV XFMR CKT 1.  b.2.Trip the BISMARK4 (652426) 230 kV to HILKEN 4 (652466) 230 kV line CKT 1.  b.3.Trip the BISMARK4 (652426) 230 kV to HERBERTW-KM4 (659128) 230 kV line CKT 1.  b.4.Trip the BISMARK4 (652426) 230 kV to WINCHESTER4 (652496) 230 kV line CKT 1.  b.5.Trip the WINCHESTER4 (652496) 230 kV to CAMPBELL 4 (652499) 230 kV line CKT 1.		
FLT9000-3PH	P1	3 Phase fault on CAMPBELL 4 (652499) 230 kV to line CKT, near CAMPBELL 4 (652499) 230 kV. a. Apply fault at the CAMPBELL 4 (652499) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. Trip generator(s) on the Bus CAMPBLPPW (659411) 0.7 kV c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.		
FLT9002-3PH	P1	3 Phase fault on CAMPBELL 4 (652499) 230 kV to line CKT, near CAMPBELL 4 (652499) 230 kV.  a. Apply fault at the CAMPBELL 4 (652499) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.		



**Table 6-1 Continued** 

		Table 6-1 Continued
Fault ID	Planning Event	Fault Descriptions
		3 Phase fault on GLENHAM4 (661038) 230 kV to line CKT, near GLENHAM4 (661038) 230 kV. a. Apply fault at the GLENHAM4 (661038) 230 kV Bus.
FLT9003-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on GLENHAM4 (661038) 230 kV to line CKT, near GLENHAM4 (661038) 230 kV. a. Apply fault at the GLENHAM4 (661038) 230 kV Bus.
FLT9004-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on WHITLOCKRM (655765) 230 kV to line CKT, near WHITLOCKRM (655765) 230 kV.
FLT9005-3PH	P1	a. Apply fault at the WHITLOCK_RM (655765) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.  3 Phase fault on WHITLOCK -RM (655765) 230 kV to line CKT, near WHITLOCK -RM
		(655765) 230 kV.
FLT9006-3PH	P1	a. Apply fault at the WHITLOCK_RM (655765) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.  3 Phase fault on GLENHAM7 (661035) 115 kV to line CKT, near GLENHAM7 (661035) 115
		kV.
FLT9007-3PH	P1	a. Apply fault at the GLENHAM7 (661035) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on BOWDLE 7 (661037) 115 kV to line CKT, near BOWDLE 7 (661037) 115 kV.
FLT9008-3PH	P1	a. Apply fault at the BOWDLE 7 (661037) 115 kV Bus.
		b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on GLENHAM4 (661038) 230 kV to line CKT , near GLENHAM4 (661038) 230 kV.
FLT9009-3PH	P1	a. Apply fault at the GLENHAM4 (661038) 230 kV Bus.
		b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on GLENHAM7 (661035) 115 kV to line CKT , near GLENHAM7 (661035) 115 kV.
FLT9010-3PH	P1	a. Apply fault at the GLENHAM7 (661035) 115 kV Bus.
		b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on GLENHAM7 (661035) 115 kV to line CKT , near GLENHAM7 (661035) 115 kV.
		a. Apply fault at the GLENHAM7 (661035) 115 kV Bus.
FLT9011-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line.  Trip generator(s) on the Bus NBCS_07PPR (659276) 12.5 kV
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.  3 Phase fault on MOBRIDG7 (661039) 115 kV to line CKT , near MOBRIDG7 (661039) 115
		kV.
FLT9012-3PH	P1	a. Apply fault at the MOBRIDG7 (661039) 115 kV Bus.
FL19012-3PH	[ [	b. Clear fault after 7 cycles by tripping the faulted line.  Trip generator(s) on the Bus NBCS_07PPR (659276) 12.5 kV
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.



**Table 6-1 Continued** 

Fault ID	Planning Event	Fault Descriptions
FLT9013-3PH	P1	3 Phase fault on MOBRIDG7 (661039) 115 kV to line CKT, near MOBRIDG7 (661039) 115 kV. a. Apply fault at the MOBRIDG7 (661039) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. Trip generator(s) on the Bus NBCS 07 -PPR (659276) 12.5 kV
EL T0044 2DIJ	D4	c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.  3 Phase fault on CAMPBELL 4 (652499) 230 kV to line CKT, near CAMPBELL 4 (652499) 230 kV. a. Apply fault at the CAMPBELL 4 (652499) 230 kV Bus.
FLT9014-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.  3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230 kV.
FLT9015-3PH	P1	a. Apply fault at the BISMARK4 (652426) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9016-3PH	P1	3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230 kV.  a. Apply fault at the BISMARK4 (652426) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9017-3PH	P1	3 Phase fault on BISMARK7 (652427) 115 kV to line CKT, near BISMARK7 (652427) 115 kV. a. Apply fault at the BISMARK7 (652427) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9018-3PH	P1	3 Phase fault on BISMARK7 (652427) 115 kV to line CKT, near BISMARK7 (652427) 115 kV.  a. Apply fault at the BISMARK7 (652427) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9019-3PH	P1	3 Phase fault on ESTBMRK7 (661029) 115 kV to line CKT, near ESTBMRK7 (661029) 115 kV.  a. Apply fault at the ESTBMRK7 (661029) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9020-3PH	P1	3 Phase fault on ESTBMRK7 (661029) 115 kV to line CKT, near ESTBMRK7 (661029) 115 kV.  a. Apply fault at the ESTBMRK7 (661029) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9021-3PH	P1	3 Phase fault on ESTBMRK7 (661029) 115 kV to line CKT, near ESTBMRK7 (661029) 115 kV.  a. Apply fault at the ESTBMRK7 (661029) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9022-3PH	P1	3 Phase fault on ESTBMRK7 (661029) 115 kV to line CKT, near ESTBMRK7 (661029) 115 kV.  a. Apply fault at the ESTBMRK7 (661029) 115 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.



**Table 6-1 Continued** 

Fault ID	Planning Event	Fault Descriptions
		3 Phase fault on BISMARK7 (652427) 115 kV to line CKT , near BISMARK7 (652427) 115
		kV.
FLT9023-3PH	P1	a. Apply fault at the BISMARK7 (652427) 115 kV Bus.
		b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on E.BISMRK-CP7 (655652) 115 kV to line CKT, near E.BISMRK-CP7
		(655652) 115 kV.
FLT9024-3PH	P1	a. Apply fault at the E.BISMRK-CP7 (655652) 115 kV Bus.
FL19024-3FH	FI	b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on E.BISMRK-CP7 (655652) 115 kV to line CKT , near E.BISMRK-CP7 (655652) 115 kV.
		a. Apply fault at the E.BISMRK-CP7 (655652) 115 kV Bus.
FLT9025-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230
		kV.
FLT9026-3PH	P1	a. Apply fault at the BISMARK4 (652426) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230
		kV.
FLT9027-3PH	P1	a. Apply fault at the JAMESTN4 (652444) 230 kV Bus.
1 1 1 3 0 2 7 - 3 1 1 1		b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.  3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230
		kV.
FI TOOOO ODU	D4	a. Apply fault at the JAMESTN4 (652444) 230 kV Bus.
FLT9028-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230 kV.
	P1	a. Apply fault at the JAMESTN4 (652444) 230 kV Bus.
FLT9029-3PH		b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230
		kV.
EL TOOSO SDU	P1	a. Apply fault at the JAMESTN4 (652444) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line.
FLT9030-3PH	FI	Trip generator(s) on the Bus G21-024-GEN1 (765522) 0.7 kV
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230
		kV.
FLT9031-3PH	P1	a. Apply fault at the JAMESTN4 (652444) 230 kV Bus.
2.00010111		b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
		3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230
		kV.
EL TOOSS SELL	D4	a. Apply fault at the BISMARK4 (652426) 230 kV Bus.
FLT9032-3PH	P1	b. Clear fault after 7 cycles by tripping the faulted line.
		c. Wait 20 cycles, and then re-close the line in (b) back into the fault.
		d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.



**Table 6-1 Continued** 

1 able 6-1 Continued						
Fault ID	Planning Event	Fault Descriptions				
FLT9033-3PH	P1	3 Phase fault on HERBERTW-KM4 (659128) 230 kV to line CKT, near HERBERTW-KM4 (659128) 230 kV. a. Apply fault at the HERBERTW-KM4 (659128) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9034-3PH	P1	3 Phase fault on HERBERTW-KM4 (659128) 230 kV to line CKT, near HERBERTW-KM4 (659128) 230 kV.  a. Apply fault at the HERBERTW-KM4 (659128) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9035-3PH	P1	3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230 kV. a. Apply fault at the JAMESTN4 (652444) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9036-3PH	P1	3 Phase fault on JAMESTN4 (652444) 230 kV to line CKT, near JAMESTN4 (652444) 230 kV. a. Apply fault at the JAMESTN4 (652444) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9037-3PH	P1	3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230 kV.  a. Apply fault at the BISMARK4 (652426) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9038-3PH	P1	3 Phase fault on HILKEN 4 (652466) 230 kV to line CKT, near HILKEN 4 (652466) 230 kV. a. Apply fault at the HILKEN 4 (652466) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9039-3PH	P1	3 Phase fault on HILKEN 4 (652466) 230 kV to line CKT, near HILKEN 4 (652466) 230 kV. a. Apply fault at the HILKEN 4 (652466) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. Trip generator(s) on the Bus WILTON_2-PPW (659273) 0.7 kV Trip generator(s) on the Bus WILTON_1-PPW (659294) 0.7 kV Trip generator(s) on the Bus WILTON 3 W (659366) 0.7 kV c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9040-3PH	P1	3 Phase fault on HILKEN 4 (652466) 230 kV to line CKT, near HILKEN 4 (652466) 230 kV. a. Apply fault at the HILKEN 4 (652466) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9041-3PH	P1	3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230 kV.  a. Apply fault at the BISMARK4 (652426) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				
FLT9042-3PH	P1	3 Phase fault on WASHBRN4 (652456) 230 kV to line CKT, near WASHBRN4 (652456) 230 kV. a. Apply fault at the WASHBRN4 (652456) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.				



**Table 6-1 Continued** 

Fault ID	Planning Event	Fault Descriptions
FLT9043-3PH	P1	3 Phase fault on WASHBRN4 (652456) 230 kV to line CKT, near WASHBRN4 (652456) 230 kV. a. Apply fault at the WASHBRN4 (652456) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9044-3PH	P1	3 Phase fault on WASHBRN4 (652456) 230 kV to line CKT, near WASHBRN4 (652456) 230 kV. a. Apply fault at the WASHBRN4 (652456) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9045-3PH	P1	3 Phase fault on BISMARK4 (652426) 230 kV to line CKT, near BISMARK4 (652426) 230 kV.  a. Apply fault at the BISMARK4 (652426) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9046-3PH	P1	3 Phase fault on WARD 4 (652296) 230 kV to line CKT, near WARD 4 (652296) 230 kV. a. Apply fault at the WARD 4 (652296) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9047-3PH	P1	3 Phase fault on WARD 4 (652296) 230 kV to line CKT, near WARD 4 (652296) 230 kV. a. Apply fault at the WARD 4 (652296) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9048-3PH	P1	3 Phase fault on WARD 4 (652296) 230 kV to line CKT, near WARD 4 (652296) 230 kV. a. Apply fault at the WARD 4 (652296) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.
FLT9049-3PH	P1	3 Phase fault on WARD 4 (652296) 230 kV to line CKT, near WARD 4 (652296) 230 kV. a. Apply fault at the WARD 4 (652296) 230 kV Bus. b. Clear fault after 7 cycles by tripping the faulted line. c. Wait 20 cycles, and then re-close the line in (b) back into the fault. d. Leave Fault on for 7 cycles, then trip the line in (b) and remove fault.

#### 6.3 Results

Table 6-2 shows the relevant results of the fault events simulated for each of the modified models. Existing DISIS base case issues are documented separately in Appendix C. The associated stability plots are also provided in Appendix C.

Table 6-2: GEN-2016-087 Dynamic Stability Results

		25SP		25WP		
Fault ID	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
FLT1000-SB	Pass	Pass	Stable	Pass	Pass	Stable
FLT1001-SB	Pass	Pass	Stable	Pass	Pass	Stable
FLT1003-SB	Pass	Pass	Stable	Pass	Pass	Stable
FLT1004-SB	Pass	Pass	Stable	Pass	Pass	Stable
FLT1005-SB	Pass	Pass	Stable	Pass	Pass	Stable

14



Table 6-2 continued

	25SP 25WP						
Fault ID	Voltage	Voltage		Voltage	Voltage		
	Violation	Recovery	Stable	Violation	Recovery	Stable	
FLT1006-SB	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9000-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9002-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9003-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9004-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9005-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9006-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9007-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9008-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9009-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9010-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9011-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9012-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9013-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9014-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9015-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9016-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9017-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9018-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9019-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9020-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9021-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9022-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9023-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9024-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9025-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9026-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9027-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9028-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9029-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9030-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9031-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9032-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9033-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9034-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9035-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9036-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9037-3PH	Pass	Pass	Stable	Pass	Pass	Stable	
FLT9038-3PH	Pass	Pass	Stable	Pass	Pass	Stable	



Table 6-2 continued

		25SP		25WP		
Fault ID	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
FLT9039-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9040-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9041-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9042-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9043-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9044-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9045-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9046-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9047-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9048-3PH	Pass	Pass	Stable	Pass	Pass	Stable
FLT9049-3PH	Pass	Pass	Stable	Pass	Pass	Stable

The results of the dynamic stability showed several existing base case issues that were found in both the original DISIS-2021-001 models and the models with the GEN-2016-087 modification included. These issues were not attributed to the GEN-2016-087 modification request and detailed in Appendix C.

There were no damping or voltage recovery violations attributed to the GEN-2016-087 modification request observed during the simulated faults. Additionally, the project was found to stay connected during the contingencies that were studied and, therefore, will meet the Low Voltage Ride Through (LVRT) requirements of FERC Order #661A.



#### 7.0 Material Modification Determination

In accordance with Attachment V of SPP's Open Access Transmission Tariff, for modifications other than those specifically permitted by Attachment V, SPP shall evaluate the proposed modifications prior to making them and inform the Interconnection Customer in writing of whether the modifications would constitute a Material Modification. Material Modification shall mean (1) modification to an Interconnection Request in the queue that has a material adverse impact on the cost or timing of any other Interconnection Request with a later Queue priority date; or (2) planned modification to an Existing Generating Facility that is undergoing evaluation for a Generating Facility Modification or Generating Facility Replacement, and has a material adverse impact on the Transmission System with respect to: i) steady-state thermal or voltage limits, ii) dynamic system stability and response, or iii) short-circuit capability limit; compared to the impacts of the Existing Generating Facility prior to the modification or replacement.

#### 7.1 Results

SPP determined the requested modification is not a Material Modification based on the results of this Modification Request Impact Study performed by Aneden. Aneden evaluated the impact of the requested modification on the prior study results. Aneden determined that the requested modification did not negatively impact the prior study dynamic stability and short circuit results, and the modifications to the project were not significant enough to change the previously studied steady-state conclusions.

This determination implies that any network upgrades already required by GEN-2016-087 would not be negatively impacted and that no new upgrades are required due to the requested modification, thus not resulting in a material adverse impact on the cost or timing of any other Interconnection Request with a later Queue priority date.

