



GEN-2025-SR2

SURPLUS SERVICE IMPACT STUDY

By SPP Generator Interconnection

Published on 09/09/2025



REVISION HISTORY

DATE OR VERSION NUMBER	AUTHOR	CHANGE DESCRIPTION	COMMENTS
09/09/2025		Original Version	

CONTENTS

REVISION HISTORY.....	I
LIST OF TABLES.....	2
LIST OF FIGURES.....	2
APPENDICES.....	2
EXECUTIVE SUMMARY	3
SCOPE OF STUDY	7
Reactive Power Analysis	7
Short Circuit Analysis	7
Stability Analysis.....	7
Steady-State Analysis	8
Necessary Interconnection Facilities & Network Upgrades.....	8
Study Limitations.....	8
SURPLUS INTERCONNECTION SERVICE REQUEST	10
REACTIVE POWER ANALYSIS	13
Methodology and Criteria	13
Results	13
SHORT CIRCUIT ANALYSIS	15
Methodology	15
Results	15
DYNAMIC STABILITY ANALYSIS.....	17
Methodology and Criteria	17
Fault Definitions.....	18
Scenario 1 Results.....	18
Scenario 2 Results.....	24
NECESSARY INTERCONNECTION FACILITIES	30
Interconnection Facilities	30
Network Upgrades.....	30
SURPLUS INTERCONNECTION SERVICE DETERMINATION AND REQUIREMENTS.....	31
Surplus Service Determination.....	31

Surplus Service Requirements.....	31
-----------------------------------	----

LIST OF TABLES

Table 1: EGF & SGF Configuration.....	3
Table 2: SGF Interconnection Configuration.....	4
Table 3: EGF & SGF Configuration.....	11
Table 4: SGF Interconnection Configuration.....	12
Table 5: Shunt Reactor Size for Reactive Power Analysis.....	13
Table 6: Short Circuit Model Parameters*	15
Table 7: POI Short Circuit Comparison Results.....	16
Table 8: 25SP Short Circuit Comparison Results	16
Table 9: Study Scenarios (Generator Dispatch MW).....	17
Table 10: Scenario 1 Dynamic Stability Results (EGF+SGF = 67.2 MW)	18
Table 10: Scenario 2 Dynamic Stability Results (SGF = 12.6 MW)	24

LIST OF FIGURES

Figure 1: GEN-2002-009 Single Line Diagram (EGF Existing Configuration*)	10
Figure 2: GEN-2002-009 & GEN-2025-SR2 Single Line Diagram (EGF & SGF Configuration)	11
Figure 3: EGF Single Line Diagram (Shunt Sizes).....	14
Figure 4: SGF & EGF Single Line Diagram (Shunt Sizes).....	14

APPENDICES

APPENDIX A: GEN-2025-SR2 Generator Dynamic Model
APPENDIX B: Short Circuit Results
APPENDIX C: Simulation Plots
APPENDIX D: Fault Definitions

EXECUTIVE SUMMARY

1898 & Co., a part of Burns & McDonnell, was retained by the Southwest Power Pool (SPP) to conduct the Surplus Interconnection Service Impact Study (Study) for GEN-2025-SR2. The purpose of the Study is to evaluate the use of Surplus Interconnection Service made available by GEN-2002-009 at its existing Point of Interconnection (POI) at the Hansford 115 kV substation in the Xcel/Southwestern Public Service (Xcel/SPS) control area.

GEN-2025-SR2, the proposed Surplus Generating Facility (SGF), will connect to the Hansford 115 kV bus via the same bay connection. GEN-2002-009, the Existing Generating Facility (EGF), has an effective Generator Interconnection Agreement (GIA) with a POI capacity of 67.2 MW and is making 12.6 MW of Surplus Interconnection Service available. According to the SPP Open Access Transmission Tariff (SPP Tariff), the available Surplus Interconnection Service for the SGF is limited to the amount of Interconnection Service granted to the EGF at the same POI. Furthermore, Surplus Interconnection Service can only be accommodated without requiring Network Upgrades, except those specified in the SPP Tariff.

The proposed SGF configuration includes 6 x Suzlon S88 Turbines Storage System Inverters, each rated at 2.5 MVA. While the SGF has a total generating capability of 12.6 MW, its injection at the POI must be limited to 67.2 MW. Combined generation from the SGF and EGF cannot exceed 67.2 MW at the POI. A Power Plant Controller (PPC) will be implemented as part of GEN-2025-SR2 to regulate and limit power injection as required. The dynamic model data for the GEN-2025-SR2 project is provided in Appendix A.

Information pertaining to the SGF and EGF configuration is shown in Table 1 below.

Table 1: EGF & SGF Configuration

Request	Interconnection Queue Capacity (MW)	Fuel Type	Point of Interconnection
GEN-2025-SR2 (SGF)	12.6	Wind	Hansford 115 kV (523195)
GEN-2002-009 (EGF)	67.2	Wind	Hansford 115 kV (523195)

The detailed SGF configuration is captured in Table 2 below.

Table 2: SGF Interconnection Configuration

Facility	EGF Configuration	SGF Configuration
Point of Interconnection	Hansford 115 kV (523195)	Hansford 115 kV (523195)
Configuration/Capacity	32 x Suzlon S88 Turbines (Wind) = 67.2 MW [dispatch] Units are rated at 2.5 MVA Total POI injection w/ GEN-2002-009 to 67.2 MW at the POI	6 x Suzlon S88 Turbines (Wind) = 12.6 MW [dispatch] Units are rated at 2.5 MVA, PPC to limit GEN-2025-SR2 to 12.6 MW Total POI injection w/ GEN-2002-009 to 67.2 MW at the POI
Generation Interconnection Line (Shared with the EGF and unchanged)	N/A	Length = 6.67 miles, 14.89 miles
	N/A	R = 0.022850 pu, 0.009470 pu
	N/A	X = 0.077670 pu, 0.038660 pu
	N/A	B = 0.009810 pu, 0.004880 pu
Main Substation Transformer ¹	EGF: (32 Inverters) X12 = 16.476% R12 = 0.411%, X23 = 18.513% R23 = 0.462%, X13 = 27.769% R13 = 0.693%, Voltage = 115/34.5/13.8 kV (YN0yn0d1), Winding1-2 MVA Rating = 90.0 MVA, Winding2-3 MVA Rating = 90.0 MVA, Winding3-1 MVA Rating = 90.0 MVA, Winding MVA Base = 100.0 MVA	EGF + SGF: (38 Inverters) X12 = 8.894% R12 = 0.326%, X23 = 2.668% R23 = 0.098%, X13 = 13.341% R13 = 0.489%, Voltage = 115/34.5/13.8 kV (YN0yn0d1), Winding1-2 MVA Rating = 54.0 MVA, Winding2-3 MVA Rating = 54.0 MVA, Winding3-1 MVA Rating = 13.5 MVA, Winding MVA Base = 54.0 MVA
Equivalent GSU Transformer ¹	X2 = 6.2162%, R2 = 1.0536%, Voltage = 34.5/0.6 kV, Winding MVA = 100 MVA Rating MVA = 95.0 MVA	X2 = 5.6765%, R2 = 0.9167%, Voltage = 34.5/0.6 kV, Winding MVA = 76.8 MVA Rating MVA = 95.0 MVA
Equivalent Collector Line ²	R = 0.005136 pu	R = 0.003616 pu
	X = 0.005023 pu	X = 0.006171 pu
	B = 0.022800 pu	B = 0.018280 pu
Generator Dynamic Model ³ & Power Factor	32 x Suzlon S88 Turbines (WT2G1) ³ Leading: 0.95 Lagging: 0.95	6 x Suzlon S88 Turbines (WT2G1) ³ Leading: 0.95 Lagging: 0.95

1) X and R based on Winding MVA, 2) All pu are on 100 MVA Base, equivalent based on average derated MVA base provided by IC, 3) DYR stability model name.

The scope of this study included reactive power analysis, short circuit analysis, and dynamic stability analysis. SPP determined that steady-state analysis was not required because the addition of the SGF does not increase the maximum active power output of 67.2 MW. In addition, the EGF was previously studied at maximum Interconnection Service under all necessary reliability conditions.

1898 & Co. performed the analyses using the study data provided for the SGF and the DISIS-2021-001 study models:

- 2025 Summer Peak (25SP)
- 2025 Winter Peak (25W)

All analyses were performed using the Siemens PTI PSS/E¹ version 34 software and the results are summarized below.

The results of the reactive power analysis using the 25SP model showed that the SGF project needed a 2.9 MVar shunt capacitor at the project substation to set the MVar injection at the POI to zero. This is necessary to offset the capacitive effect on the transmission network caused by the project's transmission line and collector system during reduced generation conditions. The information gathered from the reactive power analysis is provided as information to the Interconnection Customer and Transmission Owner (TO) and/or Transmission Operator (TOP). The applicable reactive power requirements will be further reviewed by the TO and/or TOP.

The short circuit analysis was performed using the 25SP Scenario 2 stability model modified for short circuit analysis. The results from the short circuit analysis compared the 25SP model with the EGF online and SGF not connected to the SGF study model (EGF and SGF online). The maximum contribution to three-phase fault currents in the immediate transmission systems due to the addition of the SGF was not greater than 0.022 kA. The maximum three-phase fault current level within 5 buses of the POI with the EGF and SGF generators online was 40.88 kA for the 25SP model. There was one bus with a maximum three-phase fault current over 40 kA. The maximum contribution to three-phase fault currents due to the addition of the SGF was about 0.20% and 0.022 kA. These buses are highlighted in Appendix B.

The dynamic stability analysis was performed using Siemens PTI PSS/E version 34 software for the two modified study models: 25SP and 25W, each with two dispatch scenarios. 196 fault events were simulated, which included three-phase faults and single-line-to-ground stuck breaker faults.

- Scenario 1: SGF+EGF at maximum assumed dispatch, 67.2 MW (using model provided with SGF application)
- Scenario 2: SGF at maximum dispatch, 12.6 MW

There were no new damping or voltage recovery violations attributed to the GEN-2025-SR2 surplus request observed during simulated faults. Additionally, the project was found to stay connected during the contingencies that were studied and, therefore, will meet the Low Voltage Ride Through (LVRT) requirements of FERC Order #661A.

The results of the dynamic stability for Scenario 1 and Scenario 2 and showed several existing base case issues that were found in both the original DISIS-2021-001 model and the model with Project included. Associated stability plots and existing DISIS base case issues are documented in Appendix C.

¹ Power System Simulator for Engineering

The results of the study showed that the Surplus Interconnection Service Request by GEN-2025-SR2 did not negatively impact the reliability of the Transmission System. There were no additional Interconnection Facilities or Network Upgrades identified by the analyses.

SPP has determined that GEN-2025-SR2 may utilize the requested 12.6 MW of Surplus Interconnection Service being made available by the EGF. The combined generation from both the SGF and the EGF may not exceed 67.2 MW at the POI.

The customer must install monitoring and control equipment as needed to ensure that the SGF does not exceed the granted surplus amount and to ensure that combination of the SGF and EGF power injected at the POI does not exceed the EGF's Interconnection Service amount. The monitoring and control scheme may be reviewed by the TO and documented in Appendix C of the SGF GIA.

In accordance with FERC Order No. 827, both SGF and EGF will be required to provide dynamic reactive power within the range of 0.95 leading to 0.95 lagging at the high-side of the generator substation.

It is likely that the customer may be required to reduce its generation output to 0 MW in real-time, also known as curtailment, under certain system conditions to allow system operators to maintain the reliability of the transmission network.

Nothing in this study should be construed as a guarantee of transmission service or delivery rights. If the customer wishes to obtain deliverability to final customers, a separate request for transmission service must be requested on Southwest Power Pool's OASIS by the customer.

SCOPE OF STUDY

1898 & Co., a part of Burns & McDonnell, was retained by the Southwest Power Pool (SPP) to conduct the Surplus Service Impact Study (Study) for GEN-2025-SR2, the Surplus Generating Facility (SGF). The Study aims to assess the SGF's impact on transmission system reliability and to determine any necessary additional Interconnection Facilities, in accordance with the SPP Generator Interconnection Procedures (GIP) outlined in Attachment V, Section 3.3 of the SPP Open Access Transmission Tariff (SPP Tariff).

The availability of Surplus Interconnection Service for the SGF is constrained by the Interconnection Service previously granted to the existing interconnection customer for the Existing Generating Facility (EGF) at the same Point of Interconnection (POI). Surplus Interconnection Service is only permissible to the extent it does not require additional Network Upgrades beyond those stipulated in the SPP Tariff. The scope of the Study depends on the specifications of both the EGF and SGF.

The criteria sections below outline the analyses performed within the Study's scope. All analyses were performed using the Siemens PTI PSS/E version 34 software. The results of each analysis are presented in the following sections.

REACTIVE POWER ANALYSIS

SPP requires that a reactive power analysis be performed on the requested configuration if it is a non-synchronous resource. The reactive power analysis determines the added capacitive effect at the POI caused by the project's collection system and transmission line's capacitance. A shunt reactor size was determined for the SGF to offset the capacitive effect and maintain zero (0) MVAR injection at the POI while the plant's generators and capacitors were offline.

SHORT CIRCUIT ANALYSIS

SPP requires that a short circuit analysis be performed to determine the maximum available fault current requiring interruption by protective equipment with both the SGF and EGF online, along with the amount of increase in maximum fault current due to the addition of the SGF. The analysis was performed on two scenarios, with the EGF in service and SGF offline, and the modified model with both EGF and SGF in service.

STABILITY ANALYSIS

SPP requires that a dynamic stability analysis be performed to determine whether the SGF, EGF, and the transmission system will remain stable and within applicable criteria. Dynamic stability

analysis was performed on two dispatch scenarios, the first where the SGF was online at 100% of the assumed dispatch with the EGF offline and disconnected, and the second which is determined to be the worst-case scenario based on a dispatch test described in the Stability Methodology and Criteria section. The stability analyses will identify any additional Interconnection Facilities and Network Upgrades necessary.

STEADY-STATE ANALYSIS

The steady-state (thermal/voltage) analyses may be performed as necessary to ensure that all required reliability conditions are studied. If the EGF was not studied under off-peak conditions, off-peak steady state analyses shall be performed to the required level necessary to demonstrate reliable operation of the Surplus Interconnection Service. If the original system impact study is not available for the Interconnection Service, both off-peak and peak analysis may need to be performed for the EGF associated with the request.

SPP determined that steady-state analysis was not required because the addition of the SGF does not increase the maximum active power output of 67.2 MW. In addition, the EGF was previously studied at maximum Interconnection Service under all necessary reliability conditions.

NECESSARY INTERCONNECTION FACILITIES & NETWORK UPGRADES

The SPP Tariff² states that the reactive power, short circuit/fault duty, stability, and steady-state analyses (where applicable) for the Surplus Interconnection Service will identify any additional Interconnection Facilities necessary. In addition, the analyses will determine if any Network Upgrades are required for mitigation. The Surplus Interconnection Service is only available up to the amount that can be accommodated without requiring additional Network Upgrades unless (a) those additional Network Upgrades are either (1) located at the Point of Interconnection substation and at the same voltage level as the Generating Facility with an effective GIA, or (2) are System Protection Facilities; and (b) there are no material adverse impacts on the cost or timing of any Interconnection Requests pending at the time the Surplus Interconnection Service request is submitted.

STUDY LIMITATIONS

The assessments and conclusions provided in this report are based on assumptions and information provided to 1898 & Co. by others. While the assumptions and information provided may be appropriate for the purposes of this report, 1898 & Co. does not guarantee that those conditions assumed will occur. In addition, 1898 & Co. did not independently verify the accuracy

² SPP Open Access Transmission Tariff Section 3.3.4.1

or completeness of the information provided. As such, the conclusions and results presented in this report may vary depending on the extent to which actual future conditions differ from the assumptions made or information used herein.


SURPLUS INTERCONNECTION SERVICE REQUEST

The Interconnection Customer has requested a Surplus Interconnection Service Impact Study (Study) for GEN-2025-SR2 to evaluate the Surplus Interconnection Service being made available by GEN-2002-009 at its existing Point of Interconnection (POI) at the Hansford 115 kV substation in the Xcel/Southwestern Public Service (Xcel/SPS) control area.

GEN-2025-SR2, the proposed Surplus Generating Facility (SGF), will connect to the Hansford 115 kV POI bus via a separate bay connection. GEN-2002-009 (EGF) has a nameplate capacity of 67.2 MW and is making 12.6 MW of Surplus Interconnection Service available at its POI. Per the SPP Tariff the amount of Surplus Interconnection Service available to the SGF is limited by the amount of Interconnection Service granted to the EGF at the same POI. In addition, the Surplus Interconnection Service is only available up to the amount that can be accommodated without requiring additional Network Upgrades except those specified in the SPP Tariff.

At the time of the posting of this report, the EGF is an active existing generator at the same POI at Hansford 115 kV substation. GEN-2002-009 is a wind generation plant, has a maximum summer and winter queue capacity of 67.2 MW, and has Energy Resource Interconnection Service (ERIS). The EGF was originally studied in the ICS-2008-001 cluster study. Figure 1 shows the power flow model single line diagram for the EGF configuration.

Figure 1: GEN-2002-009 Single Line Diagram (EGF Existing Configuration*)

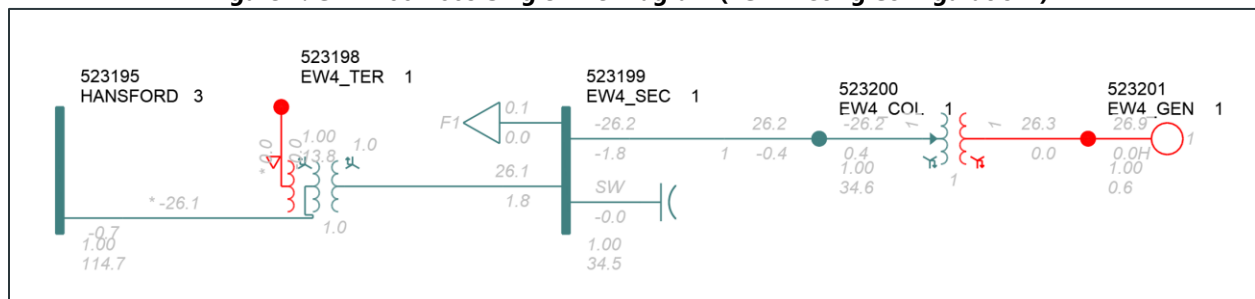

*based on the DISIS-2021-001 25SP stability models

The proposed SGF configuration consists of 6 x Suzlon S88 Turbines Storage System Inverters, each rated at 2.5 MVA. While the SGF has a total generating capability of 12.6 MW, its injection at the POI must be limited to 67.2 MW. Combined generation from the SGF and EGF cannot exceed 67.2 MW at the POI. A Power Plant Controller (PPC) will be implemented as part of GEN-2025-SR2 to regulate and limit power injection as required.

The SGF and EGF information is shown in Table 3 below, and the proposed SGF configuration is captured in Figure 2 and detailed in Table 4 .

Table 3: EGF & SGF Configuration

Request	Interconnection Queue Capacity (MW)	Fuel Type	Point of Interconnection
GEN-2025-SR2 (SGF)	12.6	Wind	Hansford 115 kV
GEN-2002-009 (EGF)	67.2	Wind	Hansford 115 kV

Figure 2: GEN-2002-009 & GEN-2025-SR2 Single Line Diagram (EGF & SGF Configuration)

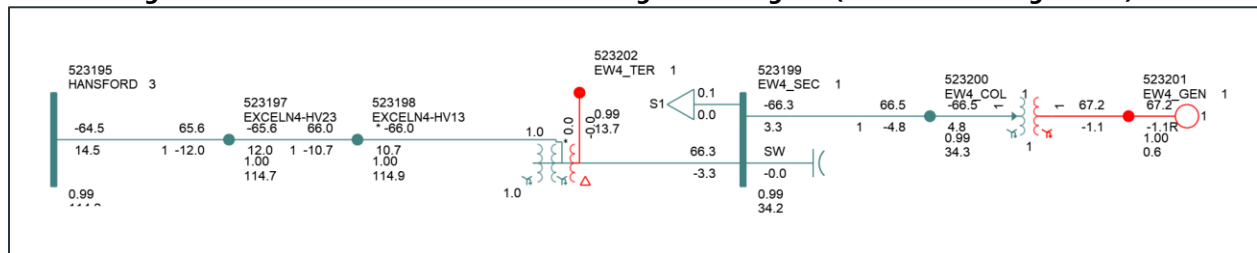


Table 4: SGF Interconnection Configuration

Facility	EGF Configuration	SGF Configuration
Point of Interconnection	Hansford 115 kV (523195)	Hansford 115 kV (523195)
Configuration/Capacity	32 x Suzlon S88 Turbines (Wind) = 67.2 MW [dispatch] Units are rated at 2.1 MVA Total POI injection w/ GEN-2002-009 to 67.2 MW at the POI	6 x Suzlon S88 Turbines (Wind) = 12.6 MW [dispatch] Units are rated at 2.1 MVA, PPC to limit GEN-2025-SR2 to 12.6 MW Total POI injection w/ GEN-2002-009 to 67.2 MW at the POI
Generation Interconnection Line (Shared with the EGF and unchanged)	N/A	Length = 6.67 miles, 14.89 miles
	N/A	R = 0.022850 pu, 0.009470 pu
	N/A	X = 0.077670 pu, 0.038660 pu
	N/A	B = 0.009810 pu, 0.004880 pu
	N/A	Rating MVA = 472 MVA
Main Substation Transformer ¹	EGF: (32 Inverters) X12 = 16.476% R12 = 0.411%, X23 = 18.513% R23 = 0.462%, X13 = 27.769% R13 = 0.693%, Voltage = 115/34.5/13.8 kV (YN0yn0d1), Winding1-2 MVA Rating = 90.0 MVA, Winding2-3 MVA Rating = 90.0 MVA, Winding3-1 MVA Rating = 90.0 MVA, Winding MVA Base = 100.0 MVA	EGF + SGF: (38 Inverters) X12 = 8.894% R12 = 0.326%, X23 = 2.668% R23 = 0.098%, X13 = 13.341% R13 = 0.489%, Voltage = 115/34.5/13.8 kV (YN0yn0d1), Winding1-2 MVA Rating = 54.0 MVA, Winding2-3 MVA Rating = 54.0 MVA, Winding3-1 MVA Rating = 13.5 MVA, Winding MVA Base = 54.0 MVA
Equivalent GSU Transformer ¹	X2 = 6.2162%, R2 = 1.0536%, Voltage = 34.5/0.6 kV, Winding MVA = 100 MVAr Rating MVA = 95.0 MVA	X2 = 5.6765%, R2 = 0.9167%, Voltage = 34.5/0.6 kV, Winding MVA = 76.8 MVAr Rating MVA = 95.0 MVA
Equivalent Collector Line ²	R = 0.005136 pu	R = 0.003616 pu
	X = 0.005023 pu	X = 0.006171 pu
	B = 0.022800 pu	B = 0.018280 pu
Generator Dynamic Model ³ & Power Factor	32 x Suzlon S88 Turbines (WT2G1) ³ Leading: 0.95 Lagging: 0.95	6 x Suzlon S88 Turbines (WT2G1) ³ Leading: 0.95 Lagging: 0.95

1) X and R based on Winding MVA, 2) All pu are on 100 MVA Base, equivalent based on average derated MVA base provided by IC, 3) DYR stability model name.

REACTIVE POWER ANALYSIS

The reactive power analysis was performed using the 25SP model to determine the capacitive charging effects due to the SGF during reduced generation conditions (unsuitable wind speeds, unsuitable solar irradiance, insufficient state of charge, idle conditions, curtailment, etc.) at the generation site, and to size shunt reactors that would set the project reactive power contribution to the POI to approximately zero.

METHODOLOGY AND CRITERIA

To determine the shunt reactor size required to compensate for the current charging attributed to the SGF collection system, all SGF components were switched offline and the EGF generator was switched offline while its other collector system elements remained in-service. A shunt reactor was tested at the project's collection substation 34.5 kV bus to set the MVar injection at the POI to zero. All SGF components except for the generator were then switched online and an additional shunt reactor was tested at the project's collection substation 34.5 kV bus to set the MVar injection at the POI to zero. The size of the shunt reactor is equivalent to the charging current value at unity voltage and the compensation provided is proportional to the voltage effects on the charging current (i.e., for voltages above unity, reactive compensation is greater than the size of the reactor).

RESULTS

The results from the analysis showed that the EGF needed an approximately 2.26 MVar shunt reactor at the EGF substation. For both the EGF and SGF, a 2.86 MVar shunt reactor is needed to set the MVar injection at the POI to zero. The final shunt reactor requirements are shown in Table 5. Figure 3 illustrates the shunt reactor size needed to set the POI MVar to approximately zero with the EGF alone, and Figure 4 illustrates the shunt reactor size needed to set the POI MVar to approximately zero with the EGF and SGF online.

Table 5: Shunt Reactor Size for Reactive Power Analysis

Machine	POI Bus Number	POI Bus Name	Shunt Size (MVar)
			25SP
GEN-2002-009 (EGF)	523195	Hansford 115 kV	-2.26
GEN-2002-009 (EGF) & GEN-2025-SR2 (SGF)	523195	Hansford 115 kV	-2.86

*The SGF collection system has a capacitive characteristic due to high GSU transformer's magnetizing B value.

Figure 3: EGF Single Line Diagram (Shunt Sizes)


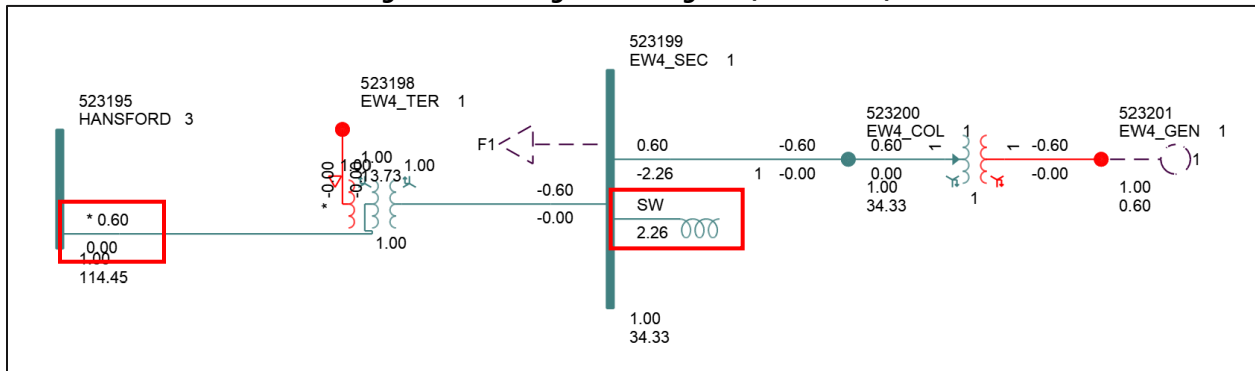


Figure 4: SGF & EGF Single Line Diagram (Shunt Sizes)

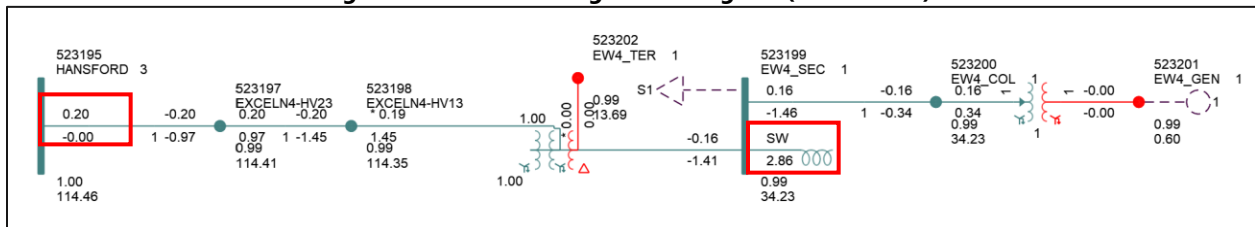

The information gathered from the reactive power analysis is provided as information to the Interconnection Customer and Transmission Owner (TO) and/or Transmission Operator (TOP). The applicable reactive power requirements will be further reviewed by the TO and/or TOP.

SHORT CIRCUIT ANALYSIS

A short circuit study was performed to determine the maximum available fault current requiring interruption by protective equipment with both the SGF and EGF online for each bus in the relevant subsystem, and the amount of increase in maximum fault current due to the addition of the SGF. The detailed results of the short circuit analysis are provided in Appendix B.

METHODOLOGY

The short circuit analysis included applying a 3-phase fault on buses up to 5 levels away from the 115 kV POI bus. The PSS/E “Automatic Sequence Fault Calculation (ASCC)” fault analysis module was used to calculate the fault current levels in the transmission system with and without the SGF online. The first scenario was studied with both the SGF and EGF in service. In the second scenario the SGF was disconnected while the EGF was online to determine the impact of the SGF.

1898 & Co. created a short circuit model using the 25SP DISIS-2021-001 stability study model by verifying that the SGF short circuit parameters were consistent with the submitted data. The parameters used in the short circuit analysis are shown in Table 6 below. No changes were made to the model.

Table 6: Short Circuit Model Parameters*

Parameter	Value by Generator Bus#
	523201 (GEN 1)
R (pu)	0.000
X'' (pu)	0.21157

*pu values based on Machine MVA Base

RESULTS

The results of the short circuit analysis compared the 25SP model with the EGF online and SGF not connected to the stability in Scenario 1. In Scenario 2 both the EGF and SGF were online. The GEN-2025-SR2 POI bus fault current magnitudes for the comparison cases are provided in Table 7 showing a fault current of 11.056 kA with the EGF and SGF online. The addition of the SGF configuration decreased the POI bus fault current by 0.022 kA. Table 8 shows the maximum fault current magnitudes and fault current increases with the SGF project online.

The maximum fault current calculated within 5 buses of the POI was 40.88 kA for the 25SP model. There was one bus with a maximum three-phase fault current over 40 kA. The maximum contribution to three-phase fault currents due to the addition of the SGF was about 0.200% and 0.022 kA. These buses are highlighted in Appendix B.

Table 7: POI Short Circuit Comparison Results

Case	EGF Only Current (kA)	SGF & EGF Current (kA)	kA Change	%Change
25SP	11.078	11.056	-0.022	-0.200%

Table 8: 25SP Short Circuit Comparison Results

Voltage (kV)	Max. Current (EGF & SGF) (kA)	Max kA Change	Max %Change
69	13.458	-0.003	-0.033%
115	40.883	-0.022	-0.200%
138	5.256	0.000	0.000%
230	29.312	-0.004	-0.030%
345	17.089	-0.002	-0.013%
Max	40.883	-0.022	-0.200%

DYNAMIC STABILITY ANALYSIS

The dynamic stability analysis was performed in accordance with SPP's Disturbance Performance Requirements³ to identify the impact of the SGF project. The dynamic model data for the GEN-2025-SR2 project is provided in Appendix A, and existing base case issues and simulation plots can be found in Appendix C.

METHODOLOGY AND CRITERIA

The dynamic stability analysis was performed using models developed with the requested 6 x Suzlon S88 Turbines operating at 2.1 MW each to model the SGF generating facility. This stability analysis was performed using Siemens PTI's PSS/E version 34.9.6 software.

The Project details were used to create modified stability models for this impact study based on the DISIS-2021-001 stability study models:

- 2025 Summer Peak (25SP),
- 2025 Winter Peak (25W)

In Scenario 1 the EGF and SGF is at 100% of the assumed dispatch (EGF+SGF = 67.2 MW) to inject 67.2 MW at the POI. In Scenario 2 the SGF is at 100% of the assumed dispatch (SGF = 12.6 MW). The study scenarios are shown in Table 9.

Table 9: Study Scenarios (Generator Dispatch MW)

Scenario	GEN-2002-009 EGF (MW)	GEN-2025-SR2 SGF (MW)	EGF+SGF (MW)	POI (MW)
1	54.6	12.	67.2	64.5
2	0	12.6	12.6	12.3

The power flow models and associated dynamic database were initialized (no-fault test) to confirm that there were no errors in the initial conditions of the system and the dynamic data. The following system adjustments were made to address existing base case issues that are not attributed to the surplus request:

- The PSSE dynamic simulation iterations and acceleration factor were adjusted as needed to resolve PSSE dynamic simulation crashes.

During the fault simulations, the active power (PELEC), reactive power (QELEC), and terminal voltage (ETERM) were monitored for the EGF and SGF and other current and prior queued

³ [SPP Disturbance Performance Requirements:](https://www.spp.org/documents/28859/spp%20disturbance%20performance%20requirements%20(twg%20approved).pdf)
[https://www.spp.org/documents/28859/spp%20disturbance%20performance%20requirements%20\(twg%20approved\).pdf](https://www.spp.org/documents/28859/spp%20disturbance%20performance%20requirements%20(twg%20approved).pdf)

projects in Group 5⁴. In addition, voltages of five (5) buses away from the POI of the SGF were monitored and plotted.

FAULT DEFINITIONS

1898 & Co. developed fault events as required for the Study for simulation on the study models. The fault events included three-phase faults and single-line-to-ground stuck breaker faults. Single-line-to-ground faults are approximated by applying a fault impedance to bring the faulted bus positive sequence voltage to 0.6 pu. 196 faults were simulated for the Study. The fault definitions can be found in Appendix D.

SCENARIO 1 RESULTS

Table 10 shows the relevant results of the fault events simulated for each of the modified models in Scenario 1.

Table 10: Scenario 1 Dynamic Stability Results (EGF+SGF = 67.2 MW)

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P1_515554_BVRCNTY7-515677_BADGER_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_515554_BVRCNTY7-515677_BADGER_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_515677_BADGER-560071_G16-003-TAP_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_515677_BADGER-560071_G16-003-TAP_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523089_TC-TXCOUNTY269000-522907_BOAR_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523089_TC-TXCOUNTY269000-523065_TC-THOMPSON269000_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523089_TC-TXCOUNTY269000-523090_Texas_Cnty_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-522912_Y_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-523089_TC-TXCOUNTY269000_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-523106_TXPHSF_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-523113_TC-MCMURRY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523090_Texas_Cnty_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523090_Texas_Cnty_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523095_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523175_LASLEY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523093_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523097_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable

⁴ Based on the DISIS-2021-001 Cluster Groups

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P1_523095_HITCHLAND-523154_OCHILTREE_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523309_MOORE_CNTY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-515554_BVRCNTY7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-515554_BVRCNTY7_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-523095_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-523823_CARPENTER_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-523961_POTTER_CO_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523120_COLE-522918_COLE_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523120_COLE-523142_TC-AGGIE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523095_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523120_COLE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523158_PERRYTON_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523158_PERRYTON_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523186_SPEARMAN_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523168_SHERMAN-523228_DALLAM_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523175_LASLEY-523093_HITCHLAND_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523175_LASLEY-523168_SHERMAN_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523175_LASLEY-523308_MOORE_E_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523186_SPEARMAN-523154_OCHILTREE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523186_SPEARMAN-523266_PRINGLE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523186_SPEARMAN-523266_PRINGLE_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523195_HANSFORD-523093_HITCHLAND_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523195_HANSFORD-523186_SPEARMAN_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523266_PRINGLE-523346_BLKHAWK_E_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523266_PRINGLE-523377_RIVERVIEW_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523266_PRINGLE-523979_HARRNG_EST_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523308_MOORE_E-523256_ETTER_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523308_MOORE_E-523309_MOORE_CNTY_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523309_MOORE_CNTY-523308_MOORE_E_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523309_MOORE_CNTY-523323_MCDWL_CREEK623000_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523323_MCDWL_CREEK623000-523322_MCDWL_CREEK311500_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523323_MCDWL_CREEK623000-523959_POTTER_CO_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523823_CARPENTER-523853_FINNEY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523823_CARPENTER-531405_WALKMYR3_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523853_FINNEY-531449_HOLCOMB7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P1_523853_FINNEY-531449_HOLCOMB7_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523959_POTTER_CO-523979_HARRNG_EST_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-511553_CHISHOLM7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-511553_CHISHOLM7_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-523959_POTTER_CO_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-525549_TOLK_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-525549_TOLK_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523977_HARRNG_WST-524010_ROLLHILLS_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523977_HARRNG_WST-524044_NICHOLS_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523977_HARRNG_WST-524162_EAST_PLANT_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523978_HARRNG_MID-523977_HARRNG_WST_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523978_HARRNG_MID-524044_NICHOLS_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523978_HARRNG_MID-524365_RANDALL_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523979_HARRNG_EST-523266_PRINGLE_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523979_HARRNG_EST-523978_HARRNG_MID_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_524044_NICHOLS-523771_GRAPEVINE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_525549_TOLK-527656_CROSSROADS_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_531449_HOLCOMB7-531465_SETAB_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_531449_HOLCOMB7-531501_BUCKNER7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515375_WWRDEHV7-ConID-138612.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515375_WWRDEHV7-ConID-139038.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-10.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-12.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-13.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-138614.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-138615.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-14.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-138609.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-138611.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-10.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-13.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-137326.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-137327.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-137328.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-14.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-15.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-16.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-18.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-19.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-20.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-22.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-23.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-137316.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P4_CON-523823_CARPENTER-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523853_FINNEY-ConID-137316.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523853_FINNEY-ConID-137325.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-137336.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-25.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-525549_TOLK-ConID-137319.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-525549_TOLK-ConID-137321.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-531501_BUCKNER7-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-531501_BUCKNER7-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-531501_BUCKNER7-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-12.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-13.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-14.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-15.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-16.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-17.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-515554_BVRCNTY7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523090_TEXAS_CNTY.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523093_HITCHLAND.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P4_HOL-523095_HITCHLAND.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523097_HITCHLAND.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523154_OCHILTREE.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523175_LASLEY.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523186_SPEARMAN.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523266_PRINGLE.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523308_MOORE_E.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523309_MOORE_CNTY.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523823_CARPENTER.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523959_POTTER_CO.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523961_POTTER_CO.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-524044_NICHOLS.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-525549_TOLK.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-531449_HOLCOMB7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-515554_BVRCNTY7-ConID-OKGE-16.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523097_HITCHLAND-ConID-SPS-118.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523097_HITCHLAND-ConID-SPS-142.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523308_MOORE_E-ConID-SPS-154.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523823_CARPENTER-ConID-SPS-108.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523853_FINNEY-ConID-SPS-117.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523959_POTTER_CO-ConID-SPS-136.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523961_POTTER_CO-ConID-SPS-125.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523961_POTTER_CO-ConID-SPS-144.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523977_HARRNG_WST-ConID-SPS-149.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523978_HARRNG_MID-ConID-SPS-150.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523978_HARRNG_MID-ConID-SPS-153.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523979_HARRNG_EST-ConID-SPS-151.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-524044_NICHOLS-ConID-SPS-134.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-524044_NICHOLS-ConID-SPS-135.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-524267_BUSHLAND-ConID-SPS-148.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-527656_CROSSROADS-ConID-SPS-109.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-527656_CROSSROADS-ConID-SPS-110.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-528223_CHINA_DRAW-ConID-SPS-111.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-528223_CHINA_DRAW-ConID-SPS-112.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-528223_CHINA_DRAW-ConID-SPS-113.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-531449_HOLCOMB7-ConID-SUNC-5.idv	Pass	Pass	Stable	Pass	Pass	Stable

SCENARIO 2 RESULTS

Table 11 shows the relevant results of the fault events simulated for each of the modified models in Scenario 2.

Table 11: Scenario 2 Dynamic Stability Results (SGF = 12.6 MW)

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P1_515554_BVRCNTY7-515677_BADGER_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_515554_BVRCNTY7-515677_BADGER_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_515677_BADGER-560071_G16-003-TAP_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_515677_BADGER-560071_G16-003-TAP_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523089_TC-TXCOUNTY269000-522907_BOAR_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523089_TC-TXCOUNTY269000-523065_TC-THOMPSON269000_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523089_TC-TXCOUNTY269000-523090_Texas_Cnty_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-522912_Y_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-523089_TC-TXCOUNTY269000_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-523106_TXPHSF_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523090_Texas_Cnty-523113_TC-MCMURRY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523090_Texas_Cnty_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523090_Texas_Cnty_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523095_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523093_HITCHLAND-523175_LASLEY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523093_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523097_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523154_OCHILTREE_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523095_HITCHLAND-523309_MOORE_Cnty_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-515554_BVRCNTY7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-515554_BVRCNTY7_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-523095_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-523823_CARPENTER_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523097_HITCHLAND-523961_POTTER_CO_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523120_COLE-522918_COLE_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523120_COLE-523142_TC-AGGIE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523095_HITCHLAND_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523120_COLE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523158_PERRYTON_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523154_OCHILTREE-523158_PERRYTON_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P1_523154_OCHILTREE-523186_SPEARMAN_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523168_SHERMAN-523228_DALLAM_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523175_LASLEY-523093_HITCHLAND_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523175_LASLEY-523168_SHERMAN_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523175_LASLEY-523308_MOORE_E_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523186_SPEARMAN-523154_OCHILTREE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523186_SPEARMAN-523266_PRINGLE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523186_SPEARMAN-523266_PRINGLE_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523195_HANSFORD-523093_HITCHLAND_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523195_HANSFORD-523186_SPEARMAN_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523266_PRINGLE-523346_BLKHAWK_E_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523266_PRINGLE-523377_RIVERVIEW_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523266_PRINGLE-523979_HARRNG_EST_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523308_MOORE_E-523256_ETTER_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523308_MOORE_E-523309_MOORE_CNTY_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523309_MOORE_CNTY-523308_MOORE_E_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523309_MOORE_CNTY-523323_MCDWL_CREEK623000_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523323_MCDWL_CREEK623000-523322_MCDWL_CREEK311500_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523323_MCDWL_CREEK623000-523959_POTTER_CO_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523823_CARPENTER-523853_FINNEY_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523823_CARPENTER-531405_WALKMYR3_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523853_FINNEY-531449_HOLCOMB7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523853_FINNEY-531449_HOLCOMB7_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523959_POTTER_CO-523979_HARRNG_EST_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-511553_CHISHOLM7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-511553_CHISHOLM7_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-523959_POTTER_CO_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-525549_TOLK_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523961_POTTER_CO-525549_TOLK_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523977_HARRNG_WST-524010_ROLLHILLS_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523977_HARRNG_WST-524044_NICHOLS_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523977_HARRNG_WST-524162_EAST_PLANT_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523978_HARRNG_MID-523977_HARRNG_WST_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523978_HARRNG_MID-524044_NICHOLS_Ckt2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523978_HARRNG_MID-524365_RANDALL_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P1_523979_HARRNG_EST-523266_PRINGLE_3Winding.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_523979_HARRNG_EST-523978_HARRNG_MID_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_524044_NICHOLS-523771_GRAPEVINE_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_525549_TOLK-527656_CROSSROADS_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_531449_HOLCOMB7-531465_SETAB_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P1_531449_HOLCOMB7-531501_BUCKNER7_Ckt1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515375_WWRDEHV7-ConID-138612.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515375_WWRDEHV7-ConID-139038.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-10.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-12.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-13.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-138614.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-138615.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-14.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515554_BVRCNTY7-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-138609.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-138611.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-515677_BADGER-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-10.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-13.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-137326.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-137327.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-137328.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P4_CON-523097_HITCHLAND-ConID-14.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-15.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-16.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-18.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-19.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-20.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-22.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-23.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523097_HITCHLAND-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-137316.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523823_CARPENTER-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523853_FINNEY-ConID-137316.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523853_FINNEY-ConID-137325.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-137336.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-25.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-3.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-4.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-5.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P4_CON-523961_POTTER_CO-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-8.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-523961_POTTER_CO-ConID-9.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-525549_TOLK-ConID-137319.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-525549_TOLK-ConID-137321.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-531501_BUCKNER7-ConID-0.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-531501_BUCKNER7-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-531501_BUCKNER7-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-1.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-11.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-12.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-13.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-14.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-15.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-16.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-17.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-2.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-6.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_CON-560071_G16-003-TAP-ConID-7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-515554_BVRCNTY7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523090_Texas_CNTY.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523093_HITCHLAND.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523095_HITCHLAND.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523097_HITCHLAND.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523154_OCHILTREE.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523175_LASLEY.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523186_SPEARMAN.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523266_PRINGLE.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523308_MOORE_E.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523309_MOORE_CNTY.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523823_CARPENTER.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523959_POTTER_CO.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-523961_POTTER_CO.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-524044_NICHOLS.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_HOL-525549_TOLK.idv	Pass	Pass	Stable	Pass	Pass	Stable

Fault ID	25SP			25WP		
	Voltage Violation	Voltage Recovery	Stable	Voltage Violation	Voltage Recovery	Stable
G05_P4_HOL-531449_HOLCOMB7.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-515554_BVRCNTY7-ConID-OKGE-16.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523097_HITCHLAND-ConID-SPS-118.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523097_HITCHLAND-ConID-SPS-142.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523308_MOORE_E-ConID-SPS-154.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523823_CARPENTER-ConID-SPS-108.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523853_FINNEY-ConID-SPS-117.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523959_POTTER_CO-ConID-SPS-136.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523961_POTTER_CO-ConID-SPS-125.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523961_POTTER_CO-ConID-SPS-144.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523977_HARRNG_WST-ConID-SPS-149.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523978_HARRNG_MID-ConID-SPS-150.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523978_HARRNG_MID-ConID-SPS-153.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-523979_HARRNG_EST-ConID-SPS-151.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-524044_NICHOLS-ConID-SPS-134.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-524044_NICHOLS-ConID-SPS-135.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-524267_BUSHLAND-ConID-SPS-148.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-527656_CROSSROADS-ConID-SPS-109.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-527656_CROSSROADS-ConID-SPS-110.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-528223_CHINA_DRAW-ConID-SPS-111.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-528223_CHINA_DRAW-ConID-SPS-112.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-528223_CHINA_DRAW-ConID-SPS-113.idv	Pass	Pass	Stable	Pass	Pass	Stable
G05_P4_TO-531449_HOLCOMB7-ConID-SUNC-5.idv	Pass	Pass	Stable	Pass	Pass	Stable

There were no new damping or voltage recovery violations attributed to the GEN-2025-SR2 surplus request observed during the simulated faults. Plots for these can be seen in Appendix C. Additionally, the project was found to stay connected during the contingencies that were studied and, therefore, will meet the Low Voltage Ride Through (LVRT) requirements of FERC Order #661A.

The results of the dynamic stability for Scenario 1 and Scenario 2 and showed several existing base case issues that were found in both the original DISIS-2021-001 model and the model with Project included. Associated stability plots and existing DISIS base case issues are documented in Appendix C.

NECESSARY INTERCONNECTION FACILITIES

This study identified the impact of the Surplus Interconnection Service request GEN-2025-SR2 on the transmission system reliability and any additional Interconnection Facilities or Network Upgrades necessary. The Surplus Interconnection Service is only available up to the amount that can be accommodated without requiring additional Network Upgrades unless (a) those additional Network Upgrades are either (1) located at the Point of Interconnection substation and at the same voltage level as the Generating Facility with an effective GIA, or (2) are System Protection Facilities; and (b) there are no material adverse impacts on the cost or timing of any Interconnection Requests pending at the time the Surplus Interconnection Service request is submitted.

INTERCONNECTION FACILITIES

This study did not identify any additional Interconnection Facilities required by the addition of the SGF.

NETWORK UPGRADES

This study did not identify any Network Upgrades required by the addition of the SGF. SPP will reach out to the TO and/or TOP to determine if there are any additional Network Upgrades that are either (1) located at the Point of Interconnection substation and at the same voltage level as the Generating Facility with an effective GIA, or (2) are System Protection Facilities.

SURPLUS INTERCONNECTION SERVICE DETERMINATION AND REQUIREMENTS

In accordance with Attachment V of the SPP Tariff, SPP shall evaluate the request for Surplus Interconnection Service and inform the Interconnection Customer in writing of whether the Surplus Interconnection Service can be utilized without negatively impacting the reliability of the Transmission System and without any additional Network Upgrades necessary except those specified in the SPP Tariff.

SURPLUS SERVICE DETERMINATION

SPP determined the request for Surplus Interconnection Service does not negatively impact the reliability of the Transmission System and no required Network Upgrades or Interconnection Facilities were identified.

1898 & Co. evaluated the impact of the requested Surplus Interconnection Service on the prior study results and determined that the requested SGF resulted in similar dynamic stability and short circuit analyses therefore the prior study steady-state results should not be negatively impacted.

SPP has determined that GEN-2025-SR2 may utilize the requested 12.6 MW of Surplus Interconnection Service being made available by GEN-2002-009.

SURPLUS SERVICE REQUIREMENTS

The amount of Surplus Interconnection Service available to be used is limited by the amount of Interconnection Service granted to the existing interconnection customer at the same POI. The combined generation from both the SGF and the EGF may not exceed 67.2 MW at the POI, which is the total Interconnection Service amount currently granted to the EGF.

The customer must install monitoring and control equipment as needed to ensure that the SGF does not exceed the granted surplus amount and to ensure that a combination of the SGF and EGF power injected at the POI does not exceed the EGF's Interconnection Service amount. The monitoring and control scheme may be reviewed by the TO and documented in Appendix C of the SGF GIA.

SPP will reach out to the TO and/or TOP to determine if there are any additional Network Upgrades that are either (1) located at the Point of Interconnection substation and at the same voltage level as the Generating Facility with an effective GIA, or (2) are System Protection Facilities.